


Dvořák – svahové sekačky s.r.o. Pohled 277, 58221 Pohled, CZ  parts@spider-cz.com	Service Bulletin	Bulletin:	78
		Date:	02.05.2016
	Hydraulic pump fun cover for ILD02SG	Informative	

Informative	Technical change, servicing not necessary
Recommended	Technical change, which reflects frequent defect. Change should be carried out during next servicing.
Obligatory	Technical change, which reflects possible danger. Immediate servicing is necessary.

GENERAL

Issue

New hydraulic pump fun cover for ILD02SG

Valid for

SPIDER ILD02SG S/N 1914 – 1947; 1962; 1986 and higher (from 2259 fitted by the manufacture)

Importance



Informative: Technical change, servicing not necessary


Background

To increase the distance between new hydraulic hoses and the fan cover and avoid possible contact at the highest cutting position.

TECHNICAL DESCRIPTION

Because of the larger knee of new hydraulic hoses Gates the whole bundle of hydraulic hoses was closer to the fan cover of hydraulic pump on ILD02SG at the highest cutting position. To avoid possible contact with hoses the fan cover has been changed. The new fan cover is 5 mm lower and holes for attaching the grid are shifted. Only fan cover for Spider ILD02 has been changed. For Spider ILD01 stays the same as before.

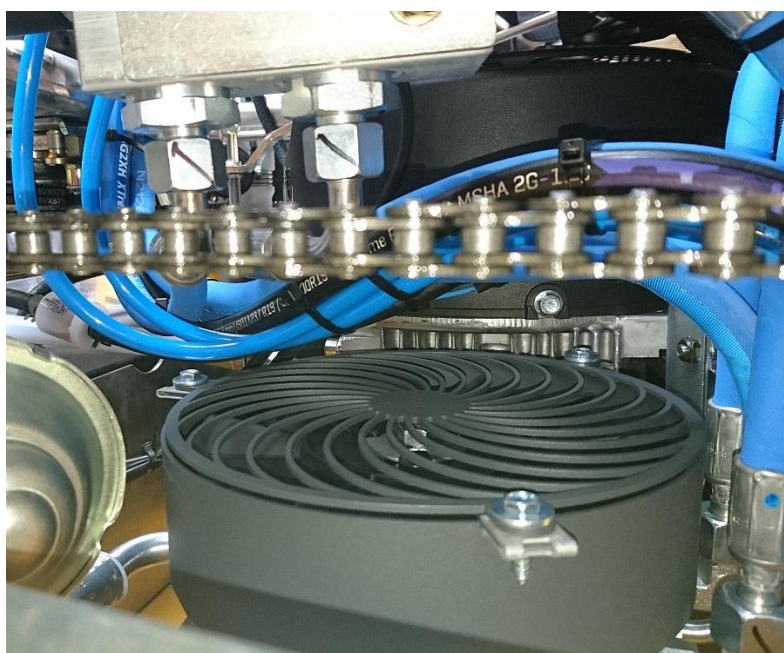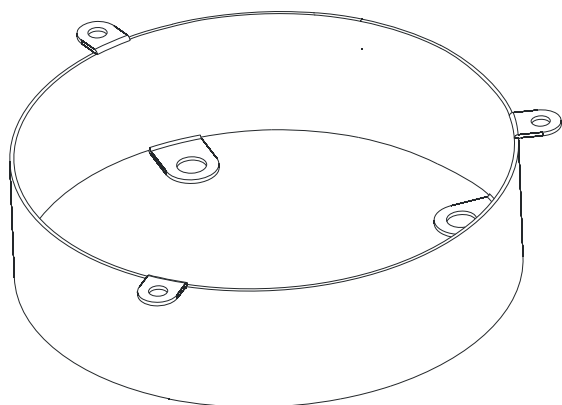

Dvořák – svahové sekačky s.r.o. Pohled 277, 58221 Pohled, CZ  parts@spider-cz.com	Service Bulletin		Bulletin:	78
			Date:	02.05.2016
	Hydraulic pump fan cover for ILD02SG		Informative	

MATERIAL

<i>Affected parts</i>			<i>replacement parts</i>		
<i>Description</i>	<i>Number</i>	<i>Qty</i>	<i>Description</i>	<i>Number</i>	<i>Qty</i>
Fan cover ILD01+ILD02	1S02S200	1	Fan cover ILD02	2S02S200	1

Price and Availability

Price: No change – the same as 1S02S200. See latest Price list

Availability: May 2016

Retrofitability

Fully compatible only for Spider ILD02